NBS Special Publication 480-18

ATTO3 087480



Report on an Investigation of the High Speed Hazards of Steel Belted Radial Tires on Police Patrol Cars



Law Enforcement Equipment Technology

U.S. DEPARTMENT OF COMMERCE National Bureau of Standards



NBS Special Publication 480-18

Report on an Investigation of the High Speed Hazards of Steel Belted **Radial Tires on** Police Cars E. Special publication no.480-18

LIBRARY JUN 3 0 1977 not acc. 51-60 17 1497

by

Jared J. Collard Law Enforcement Standards Laboratory Center for Consumer Product Technology National Bureau of Standards Washington, D. C. 20234

prepared for National Institute of Law **Enforcement and Criminal Justice** Law Enforcement Assistance Administration U.S. Department of Justice Washington, D. C. 20531



sued June 1977

U.S. DEPARTMENT OF COMMERCE, Juanita M. Kreps, Secretary Dr. Sidney Harman, Under Secretary Jordan J. Baruch, Assistant Secretary for Science and Technology US NATIONAL BUREAU OF STANDARDS, Ernest Ambler, Acting Director

Library of Congress Cataloging in Publication Data

Collard, Jared J.

Report on an investigation of the high speed hazards of steel belted radial tires on police patrol cars.

(Law enforcement equipment technology) (NBS special publication; 480-18)

Supt. of Docs. no.: C13.10/480:18

1. Police vehicles-Tires. 2. Tires, Rubber--Standards. I. National Institute of Law Enforcement and Criminal Justice. II. Law Enforcement Standards Laboratory. III. Title: Report on an investigation of the high speed hazards of steel belted radial tires. . . IV. Series. V. Series: United States. National Bureau of Standards. Special publication; 480-18.

QC100.U57 no. 480-18 [HV7936.V4] 353'.008'242 77-608082

National Bureau of Standards Special Publication 480-18 Nat. Bur. Stand. (U.S.), Spec. Publ. 480-18 40 pages CODEN:XNBSAV

U.S. GOVERNMENT PRINTING OFFICE WASHINGTON:

For sale by the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402 (Order by SD Catalog No. C13.10:480-18). Stock No. 003-003-01786-8 Price \$1.60 (Add 25 percent additional for other than U.S. mailing).

ACKNOWLEDGMENTS

This report was prepared by the Law Enforcement Standards Laboratory of the National Bureau of Standards under the direction of Jacob J. Diamond, Chief of LESL. The cooperation of the following organizations is gratefully acknowledged: the Law Enforcement Group of the National Association of Fleet Administrators, Inc., the International Association of Chiefs of Police, the Safety Research Laboratory of the National Highway Traffic Safety Administration, and the many cooperating police departments.

CONTENTS

Proface	Page
	1V
Foreword	v
Abstract	1
1.0 Introduction	1
2.0 The Investigation	1
3.0 Findings	2
4.0 Conclusions	4
5.0 Recommendations	4
6.0 Postscript	4
Table 1: Tire Failures by Construction (Data Provided by U.S. Department of Transportation)	6
Table 2: Summary of Survey by National Association of Fleet Administrators, Inc	7
Table 3: Summary of Survey by International Association of Chiefs of Police	8
Table 4: Listing of Company-Certified High Speed Police Tires	9
Attachment A: State of Alabama Traffic Accident Report	10
Attachment B: State of Alabama Report of Taylor County, Florida Accident	16
Attachment C: California Highway Patrol Test Reports	18
Attachment D: State of Florida Traffic Accident Report	23
Attachment E: Tires Company-Certified for High Speed Police Use	28

Preface

The National Institute of Law Enforcement and Criminal Justice (NILECJ), in January 1975, requested the Law Enforcement Standards Laboratory (LESL) to investigate a report that a fatal accident by a trooper of the Alabama Highway Patrol was caused by a failure of a steel belted radial ply tire at high speed. This report contains the findings of the investigation, the conclusions reached, and LESL's recommendations. No actual tire testing was conducted by the National Bureau of Standards during this investigation. The use of brand names in the report in no way implies endorsement or indictment of any particular product by the National Bureau of Standards. This report was originally published by the National Bureau of Standards in June 1975 as NBSIR 75–734. The information contained herein was current as of that date.

FOREWORD

The Law Enforcement Standards Laboratory (LESL) of the National Bureau of Standards (NBS) furnishes technical support to the National Institute of Law Enforcement and Criminal Justice (NILECJ) program to strengthen law enforcement and criminal justice in the United States. LESL's function is to conduct research that will assist law enforcement and criminal justice agencies in the selection and procurement of quality equipment.

LESL is (1) subjecting existing equipment to laboratory testing and evaluation and (2) conducting research leading to the development of several series of documents, including national voluntary equipment standards, user guidelines, state-of-the-art surveys and other reports.

This document is a law enforcement equipment report developed by LESL under the sponsorship of NILECJ. Additional reports as well as other documents are being issued under the LESL program in the areas of protective equipment, communications equipment, security systems, weapons, emergency equipment, investigative aids, vehicles and clothing.

Technical comments and suggestions concerning the subject matter of this report are invited from all interested parties. Comments should be addressed to the Law Enforcement Standards Laboratory, National Bureau of Standards, Washington, D.C. 20234.

v

Jacob J. Diamond Chief, Law Enforcement Standards Laboratory

REPORT ON AN INVESTIGATION OF THE HIGH SPEED HAZARDS OF STEEL BELTED RADIAL TIRES ON POLICE PATROL CARS

ABSTRACT

At least two police fatalities and one permanent disability were caused by catastrophic failures of steelbelted, radial-ply tires during high speed police operations. More than 200 other failures were reported by one State highway patrol department. The report concludes that general-use tires, whether steel-belted radial, fabricbelted radial, bias ply, or bias belted, are not suited to high speed use. It recommends that police departments use for high speed patrol only those models that tire manufacturers have tested and certified for use at speeds of at least 125 miles per hour. Tires of all four types are available for such use.

Key words: High speed tire hazard; police patrol car tires; radial tire failures.

1.0. INTRODUCTION

In the fall of 1974, the Law Enforcement Standards Laboratory (LESL), of the National Bureau of Standards (NBS), began to receive unconfirmed reports of a fatal police accident involving the alleged failure of a steel belted radial tire. In a letter dated December 12, 1974, John M. Grow, Manager of Transportation Services for the California Highway Patrol, expressed his concern in the following manner:

"The recent loss of life in a southern state [happened] because so many people were so uninformed that a vendor sold and the state purchased steel belted radial tires for highway patrol use. Every steel belted radial tested by us has come unglued at about 105 mph to 115 mph. Why not describe what's a high speed tire? Why not test tires and publish the results to law enforcement agencies? We would probably faint if we knew how many policemen engaged in high speed pursuit or response ride on Mickey Mouse tires every hour of every day."

LESL received a request on January 2, 1975, from the National Institute of Law Enforcement and Criminal Justice (NILECJ) to conduct a quick-response investigation of the use of steel belted radial ply (SBR) tires by police. On January 24, 1975, a preliminary memorandum report was submitted to NILECJ. This document constitutes the final report of that investigation.

2.0 THE INVESTIGATION

1. Contact was made with the Department of Public Safety, State of Alabama. A copy of the report of a fatal police accident was obtained and is provided as attachment A.

2. The State of Alabama provided LESL with a copy of a report it had prepared concerning a second fatal police accident, which had occurred in Taylor County, Florida (see attachment B). LESL made telephone contact with the Sheriff's Department of Taylor County to verify the facts.

3. Contact was made with the California Highway Patrol, which has tested several brands of steel belted radial ply tires. Copies of their test results are provided as attachment C.

4. Contact was made with the Florida Highway Patrol concerning the permanent disability of one trooper. A copy of that accident investigation report is provided as attachment D.

5. Contact was made with the Office of Defects Investigation, National Highway Traffic Safety Administration (NHTSA), to discuss elements of the Alabama fatality. The NHTSA Safety Research Laboratory was contacted and supplied information concerning the performance of various tires at high speed (see tables 1a and 1b).

6. A telephone survey of ten police agencies around the country was conducted to determine the extent to which SBRs have been or are being used or tested, and any problems experienced. This telephone survey was augmented by two larger, more detailed surveys (see 7 and 8, below).

7. The chairman of the Safety Committee of the National Association of Fleet Administrators agreed to survey the law enforcement group for user data. The results of that survey are summarized in table 2.

8. The Highway Safety Division of the International Association of Chiefs of Police was queried for user information and undertook a survey of the fifty state police organizations. A summary of the results obtained is provided in table 3.

9. The four major automobile manufacturers were contacted to ascertain company policy concerning the provision of SBRs as original or optional equipment (see Finding 2, below).

10. Several of the larger U.S. tire companies and two foreign tire companies were contacted concerning the certification and use of SBRs for law enforcement. Table 4 is a summary of attachment E, which consists of letters or announcements from several tire manufacturers listing the tires which the manufacturers have tested and certified for high speed police use. The names of the U.S. companies which manufacture high speed police tires were obtained from the Tire Industry Safety Council. This summary is provided as a convenience to the reader and does not imply endorsement or certification of the products by the National Bureau of Standards.

3.0 FINDINGS

1. The four U.S. tire industry representatives contacted by LESL stated that their companies do not recommend their standard grade SBRs for police pursuit vehicles, but that these SBRs could be, and are being, used satisfactorily on police cars where high speed is not a factor. The statement commonly heard was that U.S. steel belted radial tires "are not certified over 105 mph" (170 km/h)¹. One U.S. company reportedly is developing and testing an SBR for 125 mph (200 km/h) certification, however. Several companies are beginning to produce and market Kevlar belted tires as an alternative to SBRs. The companies report that Kevlar tires have been tested and certified up to 125 mph (200 km/h). Several U.S. companies have textile belted radial tires, as well as bias ply and bias belted tires, which they will certify for high speed pursuit. At least two foreign manufacturers have certified certain sizes of SBRs for speeds of 125 mph (200 km/h), or more (see attachment E).

2. The four U.S. automobile manufacturers are not in agreement concerning the use of U.S.-made SBRs for police operations. One company will supply domestic SBRs as optional equipment, when so specified by the ordering police agency. Another company will not supply SBRs unless the local dealer obtains a waiver of responsibility from the

¹ Standard International Metric units appear in parentheses, as a convenience to the reader. Kilometer per hour speeds are rounded to the nearest zero or 5.

ordering agency. The other two manufacturers will not put domestic SBRs on any patrol car purchased with a "police package." (The package consists of heavy duty suspension, brakes, cooling systems, etc.). However, if a patrol car is ordered without the package, SBRs may be provided, since there is no way to distinguish that car from any standard vehicle during the production process.

3. In 1974, one state trooper was killed in Alabama and in Florida, one Deputy Sheriff was killed and two state troopers were injured, one of them permanently disabled, in accidents caused by sudden failures of steel belted radial tires at speeds estimated to be between 100–110 mph (160–175 km/h). The Alabama Highway Patrol experienced approximately 40 other SBR tire failures, which resulted in light-to-moderate damage to some of the vehicles (see attachment A). In all, the surveys reported that five patrol cars have been totally destroyed and 16 damaged, as a result of SBR failures (see tables 2 and 3).

4. High speed tire failures begin with small pieces of the tread being thrown off with considerable force. This is known as "clunking," and is usually made known to the experienced driver by the noise of the chunks hitting the undercarriage or the fender walls. Unless speed is gently, but immediately, reduced, these chunks will become larger and larger, and the entire tread and steel belts may peel off (see attachment C). In many cases, enough integrity may be retained by the tire to permit the vehicle to be brought to a gradual halt. In other cases, however, the tire instantly loses air pressure. At high speed, this blow-out may send the car out of control. All of the police departments LESL contacted by telephone were aware that standard grade SBRs will not perform well at high speed, and are therefore not suitable for most patrol situations. Nevertheless, some departments are continuing to use SBRs and others are planning to switch to them because of the tire's superior treadwear, puncture resistance, and handling characteristics.

5. As can be seen from table 1a, most of the standard grade SBR's tested on a high speed wheel by the U.S. Department of Transportation (DOT) failed at 100 or 105 mph (160–165 km/h). One SBR failure occurred at 80 mph (130 km/h): another did not fail until 110 mph (175 km/h) had been reached. This variation cannot be explained without additional testing. LESL has not discovered any Government research on the problem as it specifically relates to police tires.

Table 1a also reveals that, in the DOT laboratory tests, the SBRs, on the average, fared no better and no worse than the bias ply, bias belted, and fabric radial tires. For each type of construction, the average speed at which failure occurred was approximately 100 mph (160 km/h). None of the tires tested by DOT were rated by the manufacturers as police special or high speed tires. Table 1b lists the brands and sizes of tires tested by DOT.

6. Tire failure on the road is affected by several important variables, in addition to the variability in tire construction illustrated by table 1a. These include road surface texture, ambient temperature, age and condition of the tire, inflation pressure, load on the tire, and length of running time at high speed. The fundamental cause of tire failure is heat build-up within the tire, primarily due to the rapid flexing of the tire materials, such as the belts and cords. Of all the above causes for heat build-up, improper tire inflation and high speed are the most important.

4.0 CONCLUSIONS

1. Although some standard grade SBRs may be used safely and effectively by some jurisdictions which do not patrol freeways, or certain densely populated urban areas where extremely high speeds cannot be driven, most standard grade steel belted radial tires are not suitable for county or state police operations, because of the high probability that speeds over 90 mph (145 km/h) may be achieved.

2. The improper use of SBRs is not widespread among the police. As stated above, all of the departments contacted by LESL are aware of the high speed limitations of standard grade SBRs. Some of this knowledge has come from the tire and automobile companies; in other cases, it has been gained by bitter experience. Nevertheless, a sufficient number of police departments are using SBRs, or are planning to use them, to warrant Federal action.

3. More authoritative tire information is needed by police agencies and purchasing departments, free of the biases or advertising claims of tire manufacturers. This information should be based upon actual testing of police tires, under a variety of operating conditions, and serve as a guideline for the proper selection of tires for police use.

4. Table 1a reveals that the problem of high speed tire failures is not limited to radial tires: bias and bias-belted tires will also fail at about the same speeds. The cause of the problem is the improper selection of tires for police operations. High speed driving requires high speed tires, not the standard grade tires commonly ordered by most police departments.

5.0 **RECOMMENDATIONS**

1. Joint LEAA/NHTSA notices should be issued to all law enforcement agencies, tire companies and dealers, and automobile manufacturers and dealers, informing all parties of the government's concern that standard grade steel belted radial tires are being ordered, sold, and used in situations which may be hazardous.

2. Police agencies should be advised to purchase and use only those tires which the manufacturer has certified to have been tested and approved for police use at speeds up to at least 125 mph (200 km/h). This written certification should be provided to the ordering agency upon delivery of either replacement tires or patrol cars with SBR's as original equipment.

3. Tire companies and their dealers should be cautioned against selling to the police (federal, state, county or local) any tire that has not passed the company's own high speed certification tests. The test procedures, results, and certification should be made a standard part of a tire company's bid package.

4. All automobile manufacturers should be urged, or required, to adopt a uniform policy concerning the provision of high speed tires on new police vehicles.

6.0 POSTSCRIPT

This report has dealt with the problems encountered by police using standard grade steel belted radial tires at high speeds. This should not be construed as an indictment of the use of SBR's by the general public, as long as the posted speed limits are observed and the tires receive reasonable care and maintenance. Any tire—bias, bias belted, or radial—will fail when it is abused, which includes driving at speeds beyond the tire's design maximum. Undoubtedly, failures of non-radial tires have also occurred over the years and have caused police injuries and fatalities. While it is impossible to eliminate the occurrence of tire failures, it is possible to reduce them through the use of better performance specifications for tire procurement, as well as improved tire safety and maintenance programs.

 $\mathbf{5}$

TABLE la

Tire Failures by Construction^a

					Speed at	Failure ^b						Average	Total
Construction	mph km/h	80 129	85 137	90 145	95 153	100 161	105 169	110 177	115 185	120 193	Did not fail	speed at failure	number of tires tested
Bias Ply		_	-	1	4	14	5	1	2	-	_	101 mph (162 km/b)	27
Bias Belted		-	2	4	6	2	4	1	3	-	2°	101 mph (162 km/h)	24
Fabric Radial		_	1		4	2	1	3	-	-		100 mph (161 km/h)	11
Steel Radial		1	_	1	2	9	10	1	-	-	-	101 mph (162 km/h)	24
													86

^a This analysis is based upon data provided by the Safety Research Laboratory, U.S. Department of Transportation. Tires were standard grade passenger tires selected from stocks on hand.

^b DOT TEST PROCEDURE

Break-in at 50 mph (80.5 km/h) for four hours; cool tires to ambient temperature (100°F or 37.8°C); run tires for 30 minutes at 75 mph (120.8 km/h); increase speed in 5 mph (8.1 km/h) increments and run for 30 minutes at each new speed until failure occurs.

^c Two tires withstood 30 minutes at 120 mph (193 km/h) without failure: the tests were suspended at that point. For averaging purposes, these were assumed to have failed at 125 mph (201 km/h).

TABLE 1b

Tire Brands Tested by the U.S. Department of Transportation

Bias Ply

Dunlop Gold Cup, G78-14 Firestone 500, G75-15 Firestone Delux Champion, F78-14 Goodrich Custom, G78-14 Goodyear Power Cushion 78, G78-14 Kelly Springfield 78, G78-14

Bias Belted

Dunlop Qualifier, G/T, G70-14 Firestone 500 steel belted, F78-14 Firestone Sup-R-Belt, H78-15 General Jumbo 700, F70-14 Goodycar Custom Power Cushion, H78-14 Goodyear Custom W.T., G70-14 Kelly Springfield Super Charger, G70-14

Fabric Radial

Dunlop SP41, 205R14 General Jet RADAN, 205R14 Goodrich 990, FR70-14

Steel Radial

Firestone V-1, GR70-14 Gislavd Veloche 116, 175SR14 Goodrich Lifesaver, GR70-14 Goodyear Custom Steel Guard, GR78-15 Michelin, 205-14 Pirelli Cinturato CN75, 205-14 Sears, 205-14

6

TABLE 2 5UMMARY OF NATIONAL AS5OCIATION OF FLEET ADMINISTRATORS SURVEY OF STEEL BELTED RADIAL TIRE USE BY POLICE

POLICE	TESTED OR	HOW	HOW		INSTANCES AND TYPE OF TIRE	EST. MPH SPEED AT	EST. TIRE	EST, NO, OF MILES	MAKE & 517E	DAMAGE TO	ANY INJURIES OB	LISER'S
DEPARTMENT	58R's	CARS	USE?	REPLACEMENT	FAILURE	FAILURE	PRESSURE	ON TIRE	OF TIRE USED	VEHICLE	FATALITIE5	COMMENT5
Arizong Dept, of Public Safety	Yes	25- 50	1 1/2 yrs.	Original & replacement	Yes; belt separations & sidewalls	Over 80	32 psi	Various	Goodrich Goodyear & Uniroyal (sizes not provided)	No	No	Mostly separations at high speed; have switched to fabric belted radials
Baltimore County Police Dept,	Yes	12	No answer	Replacement	Yes; belt separations	High	30 psi	Under 10,000	5ears; Michelin 205-15; Dunlop H78-15; 8FG HR70-15	No	No	Important to maintain air pressure at 30 psi
Calif. Highway Patrol	Yes	10	Test only	Replacement	Yes, belt separations and chunking	105 up	32 psi	40 - 50	HR78-15	No	No	All steel belted radials inadequate for pursuit
Georgia Dept. of Public Safety	Yes	2	Test only	Replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	Not perfected enough to include in bidding
Illinois State Police	Yes	10	15-20,000 miles	Original	No	N/A	N/A	N/A	N/A	N/A	N/A	-
Illinois State Toll Highway Authority	Yes	5	40,000	Replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	Sidewalls have cracked or split
Indianapolis, Ind. Police Dept,	Yes	10	No answer	Replacement	No	N/A	N/A	N/A	GR78-15	N/A	N/A	Sidewall damage bad; tread held up well
Kansas Highway Patrol	Yes	6	3 months	Original	Yes, partial belt separation	120	30 psi	8,000	Goodyear HR78-15	Yes	No	2 tires failed in high speed chase
Kansas City, Mo. Police Dept.	Yes	20	6 months	Replacement	Yes; sidewalls	Unknown	32 psi	Average 13,000	Gillette GR78-15 Goodyear GR78-15 Goodrich GR70-15 Michelin XWW205-15 Firestone V-1	No	No	Total of 10 failures
Kentucky State Police	Yes	2	10/1/74	Replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	Testing Pirellis
Louisville, Ky. Police Dept.	Yes	190	2 years	Original and replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	
Maine State Police	Yes	4	6 months	Replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	-
Miami, Florida Police Dept.	Yes	5	2 months	1 original; 4 replacement	Yes; wire came through sidewalls	Unknown	30-32	15,000	Goodyear GR70-15	No	No	All 20 tires removed approx, 15,000 miles
Nebraska State Patrol	Yes, tested	5	40,000 + miles	Replacement	No	N/A	N/A	N/A	N/A	N/A	N/A	Tests conducted with Michelins; just installed Michelin XV5 on 4 units; no results yet
New Jersey State Police	No	-	-	-	-	-	-	-	-	-	~	20% failure with fabric radials; eliminating all radials from use
New Mexico State Police	Yes	5	Life of tire	Replacement	Yes; sidewałł cracking	Unknown	26 psi	18,000	LR78-15	No	No	
New York City Police Dept,	Yes	34	14,000 miles	Replacement	Yes; 21 cut sidewalls; 3 blowouts	Normal cruising	28 psi	Under 7,000	Firestone GR70-15 Goodrich GR70-15 Michelin GR78-15 Goodyear GR78-15	No	No	29 patrolcars, 5 super- visor cars; no problems with supervisor's tires
Oakland County, Mich, Sheriffs Dept,	Yes	30	1 year	Original & replacement	Yes; belt separation	90 +	28-32 psi	New	Firestone HR78-15	Yes	No	-
Dntario, Canada Provincial Police	Yes	12	1 year	Original	Yes, belt separations	115	26 psi	150	Goodyear FR78-14	No	No	
Penn, State Police	Yes, Winter	100	1 season	Replacement	Yes; belt coming off & sidewall bubbles	55	30 psi	30,000	HR70-15	No	No	Now procure only fabric radials
South Carolina Highway Dept.	Yes	50	6 months	Replacement	No	N/A	N/A	N/A	(no answer)	N/A	N/A	Used only on admin, cars
Texas Dept. of Public Safety	Yes	10	30,000 miles	Replacement	Yes, one belt separation	80 +	33 psi	12,000	HR78-15	No	No	All vehicles in test were pursuit vehicles
Utah Highwaγ Patrol	Yes	1	9 months	Replacement	Yes; sidewall	55	32 psi	2500	Goodyear HR78-15	No	No	Tire adjusted by dealer

e d n p e	of icles ipped not	No. of High Speed Failures 40	Nature of Failures Belt separations, blowouts, sidewall	Approximate Speed (mph) 75-125	Est, Time Speed Maintained Did not specify	ASSOCIATID1 Approx. Tire Pressure at Time of Accident Did not specify	N DF CHIEFS OI Est. No. of Miles on Tire(s) Did not specify	PDLICE Did Failures Result in Accidents or Non-accidents 1	Did Faitures Result in Fetalities/ Injuries?	Did Failures Result in Damage to Police Vehicle 1 patrol car destroyed	Other Property Damage Did not specify	Brand/Size of Tires Firestone HR78-15 Firestone HR70-15	Comments Comments HR78-15 had 15% failunes: HR70-15 had 10% failures: JR70-15 had 2%
blisters, sid oollapsed ecify is dewalls	blisters, sid collapsed 12 Sidewalls	blisters, sid collapsed Sidewalls	ewalls	Did not specify	Did not specify	32 psi	Did not specify	Did not specify	Did not specify	Oid not specify	Did not specify	Firestone JR70-15 Firestone GR70-15 Goodyear HR70-15	rallures; but/2-15 no rallures; but used very little. Now using 8. F, Goodrich Life Saver radials; no failures to report
25 207 Belt separati sidewall blist	207 Belt separatic sidewal? blis	Belt separatic sidewalł blist	ins, lers	60-120	2 «15 miles	28-32 psi	Various	207	2 injuries	1 patrol car destroyed; 10 cars damaged	None	Firestone HR70-15 Firestone HR78-15 Goodyear HR70-15	I
0 4 Belts and sidewalls	4 Belts and sidewalls	Belts and sidewalls		Not specified	Not specified	28-30 psi	10,000	35	None	None	None	Firestone HR78-15	1
0 N/A	0 N/A	N/A		N/A	NA	N/A	N/A	N/A	N/A	N/A	N/A	Goodyear HR78-15	Have also used Firestone steel belted, Goodrich, Uniroyal, and Kell Springfield fabric radial with no trouble.
0 0 N/A	0 N/A	N/A		N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Firestone "500" JR78-15	E
2 Belt separation	2 Belt separation	Belt separation	w	120	3 minutes	30 psi	8,000	-	None	1 patrol car damaged	None	Goodyear HR78 (rim size not given)	Six vehicles delivered by mistake with steel belted radials. After 2 failures factory replaced with fabric radials
0 N/A	0 N/A	N/A		N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Goodyear HR78-15 General HR78-15	Officers advised of potential hazaro factor over 80 mph.
0 N/A	0 N/A	N/A		N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Michelin H78-15	No difficulties; troopers like them,
0 4 Belt separation	4 Belt separation	8elt separation	s	55-100	Unknown	Mfr. recomm.	10,000- 29,000	4	No	Minor fender damage to 2 cars	None	Michelin HR78-15	1
2 1 Belt separation	1 Belt separation	Belt separation		114	Пикломп	26 psi	150	4	No	No	None	Goodyear, Firestone, Uniroyal; H, G, F sizes	
00 Statistics Belt separation not maintained	Statistics Belt separation not maintained	Belt separation	s	Unknown	Пакломп	32 psi	"Almost new"	Statistics not maintained	No	No	None	Goodyear HR78-15	In 1974 Goodyear recalled 500 HR78-15 steel belted radials; now using Goodrich HR70-15 fabric i belted radials
0 0 N/A	0 N/A	N/A		N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Firestone HR78-15 Gillette HR78-15 Dayton HR78-15 (or HR70-15)	
id not 2 · Tread becify disintegration	2 · Tread disintegration	Tread disintegration	w	Did not specify	Did not specify	Did not specify	Did not specify	F	Minor injuries to driver	1 police car destroyed	Did not specify	Firestone V-1, size not specified	Both failures occurred same hour of day, with one mile of each other. Due tire maintained air, Improper inflation may have contributed to failures
0 N/A	0 N/A	N/A		N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Firestone JR78-15 Goodyear JR78-15 Firestone HR78-15 Goodyear JR78-15	Vehicles with steel radials not use for patrol.
55 2 Sidewalls	2 Sidewalls	Sidewalls		"Patrol speed"	Unknown	30 psi	1 new; 1 with 16.000 milos	None	No	No	None	Goodrich HR78-15 Goodyear HR78-15	Have successfully used police radi tires since 1965

Tire			Company-Ceri Rati	tified Speed ng
Description	Construction	Tire Size	uph	km/h
Pursuit 70, Bias Ply	Nylon	G70-15	125	200
RS Patrol	Nylon Delinerative Andrea	G, H78-15	125	200
ENICE N.2.1 GILOI	rolyester/Acviar/Avion	HR 78-15	125	200
Super 125, Bias Ply Super 125, Radial	Nylon Polyester/Kevlar	G, H78-15 HR78-15	125 125	200 200
Pursuit Radial	Rayon	GR, HR, JR70-15	125	200
Police Special Bias Ply Police Special Polyglass	Nylon Polyester/Fiberglass	G, H, J78-15 G, H, L78-15	125 125	200 200
Police Special Radial	Polyester/Rayon	DR70-14: GR, HR70-15, HR, JR, LR78-15	125	200
Radial	Steel	205 HR14 XVS 215 HR15 XVS	130 130	210 210
Radial	Steel	215-15 (HR78-15) 235-15 (LR78-15)	130 130	210 210
	Tire Description Pursuit 70, Bias Ply RS Patrol Elite RS Patrol Elite RS Patrol Elite RS Patrol Super 125, Bias Ply Pursuit Radial Police Special Bias Ply Police Special Radial Radial Radial	Tire Construction Description Construction Pursuit 70, Bias Ply Nylon RS Patrol Nylon RS Patrol Nylon Super 125, Bias Ply Nylon Super 125, Radial Nylon Pursuit Radial Rayon Police Special Bias Ply Nylon Radial Steel Radial Steel	Tite Description Construction Tire Size Pursuit 70, Bias Ply Nylon C70-15 Pursuit 70, Bias Ply Nylon C70-15 RS Patrol Nylon C70-15 Rile RS Patrol Nylon C70-15 Rile RS Patrol Nylon C70-15 Super 125, Bias Ply Nylon C4 T8-15 Super 125, Badial Nylon C4 T8-15 Pursuit Radial Rayon C4 T8-15 Pursuit Radial Rayon C4 HR. JR70-15 Police Special Bias Ply Nylon C4 H. L78-15 Police Special Bias Ply Nylon C4 H. L78-15 Radial Bolyester/Fiberglass C4 H. L78-15 Radial Steel 205 HR14 XV5 Radial Steel 215 HR15 XV5 Radial Steel 215 HR15 XV5	Tite Description Company-Cer Rati Description Tite Description Company-Cer Ration Pursuit 70, Bias Ply Nylon Construction Tire Size mph Pursuit 70, Bias Ply Nylon G70-15 125 125 RS Patrol Nylon G, H78-15 125 125 Super 125, Bias Ply Nylon G, H78-15 125 Super 125, Bas Ply Nylon G, H78-15 125 Super 125, Bas Ply Nylon G, H78-15 125 Pursuit Radial Rayon G, H78-15 125 Pursuit Radial Rayon G, H, L78-15 125 Police Special Bias Ply Nylon G, H, L78-15 125 Police Special Rolial Polyester/Fiberglass G, H, L78-15 125 Police Special Rolial Polyester/Fiberglass G, H, L78-15 125 Radial Steel 205 HR14 XVS 126 Radial Steel 215-16 (H78-15) 130

ATTACHMENT A



STATE OF ALABAMA DEPARTMENT OF PUBLIC SAFETY MONTGOMERY, ALABAMA 36102

COLONEL ELDRED C. OOTHARD DIRECTOR OF PUBLIC SAFETY December 26, 1974

LT. COLONEL C. W. RUSSEL ASSISTANT DIRECTOR

Mr. Jared Collard Law Enforcement Standards Laboratory Bureau of Standards Washington, D. C. 20234

Dear Mr. Collard:

In response to your telephone request today, I am enclosing the items of information you requested concerning our experience with Firestone Steel Radial 500 V-1 tires.

Sergeant Julian D. Stuckey of this Department's Highway Patrol Division was killed June 27, 1974, near Evergreen on I-65, after the right rear tire blew out on his patrol car at an estimated speed of 100-110 MPH. A copy of the accident report is attached together with photos of the defective tire.

After the accident, all Firestone tires were removed from the department's pursuit cars. Since the department had no test facility for the tires, Mr. Andrew Detrick of the Department of Transportation's Office of Defects Investigation was contacted and asked to test a representative sample of Firestone tires in our stock. Further instructions as to shipping procedures were given by Mr. Bob McKenzie (202/426-2102) and Mr. Carlos Garza (202/426-2834) of the Office of Defects Investigation.

On August 8, 1974, fourteen tires were shipped to each testing laboratory designated by Mr. Garza: Compliance Testing, Incorporated, Junction State Roads 14 & 88, Ravenna, Ohio and Deyton T. Brown, 555 Church Street, Bohemia, Long Island, New York 11716. Since three tire sizes, JR70x15, HR70x15 and HR78x15, were shipped to each of the laboratories, another request was received for additional tires to provide a representative sample of fourteen tires of each size to the laboratories. Subsequently, on August 29, 1974, an additional twenty-eight tires were shipped to each laboratory. No report has been received on the results of these tests.

If I can provide you with additional information on this subject, please let me know.

Sincerely yours, Harald, & Hanmond Harold J. Hammond, Lieutenant

Planning & Research Unit

DRIVE CAREFULLY -- SAVE A LIFE



STATE OF ALABAMA DEPARTMENT OF PUBLIC SAFETY MONTGOMERY, ALABAMA 34102

August 8, 1974

Mr. Carlos Garzs Office of Standards Enforcement Netional Highway Treffic Administration Department of Transportation #2100 Second Streat, S. W. Weshington, D. C. #20590

Deer Mr. Garza:

The Alebeme Department of Public Safety has run e survey of tha Firestone tires which the troopers have baen using for tha past saver months and the following facts are noted. There was e total of Prirestone tires HR 70 x 15 issued throughout the state with a total of 20 failures. The seriel number of these failures was VCU 7 VHU303 with e totel of 14 failures. One of these involved an eccider in which one of our troopers was killed. The other HR 70s that for dwere two (2) with a seriel number VCU 7 VHU 293.

The othar tire thet we've had e good many failures with was the Pirestone HR 78. Tha serial number VDVY FNJ 443 series had nine (9) for pres, the VDVY FNJ 373 had five (5) failures, the VDVY FNJ 313 had fiva (5) failuras, VDUY FNR 353 (2) failuras, VDVY FNR 383, two (2) failures end sevaral othar sarial numbers with one feilure.

What we consider feilures are blowouts, bubbles in tires, blieend separations.

We are sending the two testing laboratories tires with VCU YHU 303, HR 70, VDVY FNJ 373, HR 78, VDVY FNJ 443, HR 78, VDVY FNG 313, HR 78 and VEU 9 XMV 053, JR 70 numbers. These tires should be shipped to the tasting laboratories the latter pert of this week.

We hope to have some results from the testing laboratories in the next few waeks.

I trust this is tha information you needed. If I cen be of further assistence, pleese give us a call.

Sincerely yours,

W. J. Smith, Lieutenent Planning and Research Unit

WJS/kh

		Department Vehicle / Fatal, Fy	24	
ľ,	11	ALABAMA UNIFORM TRAFFIC ACCIDENT REPORT	<u>ب</u> مر	\$6.4 9
SHAC	EU A	ALEAS TO BE SEED BY DUTA PROCESSING ONLY SHEET CP SHEET.SI	L. ZIO Sign	
ME	0ć	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	2 - US	te 3 - Srate 5 - City 4 - County 6 - Other
Ē	Veh	Celes INVOLVED 2 - OVERTURNED IN ROAD 5 - PEDALCYCLE 4 - PEDALYCLE CELES 0 - FIXEL Cless INVOLVED 2 - OVERTURNED IN ROAD 5 - PEDALCYCLE AND OF ROAD 3 OVERTURNED IN ROAD	DOBJECT	PROM
Z	ON	or Morel 3 HAN OPP HOAD BEING DOCTORE 9- OTHER EDGE	OF ROADWAY	MILE POST NUMBER
ATIC	I	- 65 Conecuh Co. # 22 Evergreen City Limit	5	,9,9.7,0
00	Ι	$\begin{array}{ c c c c c c c c c c c c c c c c c c c$	NESWOF	
L	CIT	CONTROLLED ACCESS HWY OD-MAIN ROAD 3-MAIN ROAD AF 4-ENTRANCE R LOCATION ICICIE Drei 2-FRONTAGE RD INTERCHANGE S-EXIT RAMP	AMP NEC	W O- BOUND LAILE
1×	~	Julian D. Stuckey P. C. Box 1905 Dothan, Al. 36301	CATE OF	BIRTH SEX HACE
17	VEF	ORIVER LICENSE NUMBER STATE TYPE O AUTO 3 - MOTORCYCLE 5 - LEARNER LICENSE REST 1514366 AI . TYPE O AUTO 4 - OTHER TRUCK 6 - NONE NOTE	RICTION(S)	
	DRI	State Troopers 792-2174 DRIVER CONDITION ON OAPPARENT OFFECTS 3 - FATIGUEO 5 - I Climite One) 2 - APPARENTLY ASLEEP 4 - ILL 5 - PHYS	ICAL OFFECTS	
		DRIVER DRIVKING. YES UNKNOWN TYPE TEST GIVEN TEST RESULTS REFUSED	NO CONTRIBU	23,37
		74 FORD U D F4U53C141999 INSPECTION 1-FURAENT C-NONE LICENS S-	289	AL. 74
		Street of Ala. Dect. Public Safety P.C. Box 1511 Montgomery, Al. 3610	2 55	MPH 1.00-110 MPH
14		TYPE: O AUTO 04 - PANEL- PICKUP 07 COMM BUS 10 MCYCLE SAFETY EQUIP. USEO: YES NO		CIRCLE POINT OF
N	щ	(Circle One) 03 - STA WAGO?I 06 - OTHER TRUCK 09 - OTHER 8US 12 - OTHER		INITIAL IMPACT
	EC.	SPECIAL USE: 01 - NONE 03 - MILITARY 05 - FARM USE 07 - WRECKER 09 - ORIVER TRAINING (Circle Gree) 1/2 - TAXI 04 - AMBULANCE POLICE 03 - FIRE FIGHTING 10 - GOV'T 11 - CTHER		IST. MIL. 12
	NE N	ATTACHMENT: C2 NOVE 2 - SEMI-TRAILER 5 - CARM-TRAILER 7 - CAMPER TRAILER 9 - PETROLEUM TANKER [Circle One) 2 - MOBILE HOME 4 - UTILITY TRAILER 6 TRAILER WITH BOAT 8 - TOWED MOTOR VEH. 0 - OTHER	V//X////	
		DEFECTS: 1 - NONE 3 - LIGHTS 5 - STEERING 7 - TURN SIGNALS 9 - NOT KNOWAI (Circle One or More) 2 - BRAKES 4 - HORN 6 - WIPERS OF TIRES 0 - OTHER CODES	ontributed To Acc.	
		OAMAGE SEVERITY: AREASI DAMAGEO 11 COMA APPROXIMATE COST 4800.00	NO	
		J & B Motors State Trooper Office THISUNIT:	PANTS	
		Evergreen, Al.	1	U UNDERCARRIAGE
		DIMEN OR POUSINIANS NAME STREET OR N.P.D. CITY & STATE ZIP	DATEOF	SIRTH SEX HURE
z	NE	ORIVER LICENSE NUMBER STATE TYPE: 1 - AUTO 3 - MOTORCYCLE 5 - LEARNER LICENSE REST 2 - REG. TRUCK 4 - OTHER TRUCK 6 NONE	TRICTION(S)	Complied With YES NO
RIA	DRI	OCCUPATION COLORATION COLORATION CONDITION CONDITICON CON	IGWN	
EST		DRIVER OR PED. ORINKING: YES NO UNKNOWN TYPE TEST GIVEN TEST RESULTS REFUSE SOBRIETY: DRUGS, YES NO UNKNOWN YES	NO CONTRI	BUTING CIRCUMSTANCEIS
E C		YEAR MAKE 800Y V.I.N. INSPECTION 1-CURRENT 3-NONE LICEN CERTIFICATE: 2-EXPIRED 4-UNITIONIN	SE TAG NUMBER	STATE YEAR
		GWNER'S NAME STREET OR R F.D. CITY & STATE ZI	SPEED LIM	AIRH STIMATED SPEED
1~		TYPE 01 - AUTO 01 - PAVEL PICKUP 07 - COMM. BUS CYCLE SAFETY EQUIP. USED: YES NO 02 - PEDALCYCLE 05 - TA. TRACTOR 08 - SCHOOL BUS TI - FAMLMACH.		CIRCLE POINT OF
ō	щ	Circle 03 - STAWAGON 06 - OTHER TRUCK 09 - OTHER BUS 12 - OTHER		INTIAL IMPACT
# 2	E	SPECIAL USE: 01-NONE 03-MILITARY 05-FARM USE OF WAREKER 09-DRIVER TRAINING 1Gride One) 02-TAXI 04-AMBULANCE 06-POLICE C5-FIRE FIGHTING 10-GOV'T 11-OTHER		
E	2	ATTACHMENT: 1 - NONE 3 - SEMI-TRAILE 5 - FARM (RAILER 7 - CAMPER TRAILER 9 - PETROLENT TANKE (Circle One) 2 - MOBILE HOME 4 - UTILIT HAILER 6 - TRAILER WITH BOAT 8 - TOWED MOTOR VEH 9 - OTHER	R Miller	
jc j		DEFECTS: 1 - NONE 3 - LIGHT 5 - STEERING 7 - TURN SIGNALS 9 - NOT KNOWN Crude One or Morel 2 - BRAKES 4 - ORN 5 - WIPERS 3 - TIRES 0 - OTHER CODES	on the ted to ALE.	
		DAINAGE SEVERITY AREAS DAMAGED UN ONE APAGKIMATE COST VEHICLI I - SLIGHT 2 - MODERAFE 3 - SEVERE TO REPAIR SY	ES TOIVED AWAY	X AV
		VEHICLE TOWERE: TOTAL OCCU THIS UNIT	PANTS	G UNDERCARPIADE
	\vdash	, Griels Grie For Eben Vihicler		
	VEN	1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2		Toding Nets = are
SNO	D3CI	1. Johnson (1997) - Standar Johnson (19	PEDI-	Diraciya
Ĕ	AN	ROAD L DARK 2 - LIGHT CLOTHING 1 - DARK 2 - LIGHT RETRO- REFLECTIVE MATERIALS: 1 - CLOTHING	2 - ITEMS 3 - NONI	E 1////////
A	STRI	01 – Crossing or Entering Intersection 04 – Walking in Rdwy Against Traff 07 – Pushing or Working on Vehicle 10 – Other in Road	vay	
	EDE	02 – Crossing or Entering Other 05 – Standing in Roadway <u>03 – Other Working th Adivy</u> 11 – Malun Rhadwa 03 – Walking in Roadwa U5 – Getting Off or On Vehicle 09 – Playing in Roadway 12 – OTHER	Y	
-	OAM. TT	AGE 10 PROPERTY OTHER THAN VEHICLE (Name, Object, Show Uwnership & Damage)		Approx, Cost to Repair
-	WIT	NESS FULL NAME ADDRESS	2001 -7662	AGE SEX
NIT.	2- WIT	. F. Lee 3266 Windwood Dr. Montgomery, AL.	201-1002	AGE SEX
F	J	ack Laward Gantt Rt. C Lvergreen 5	10-1401	20 M

AST NO. 2/ REVISED 1 JAN 71

	SEATING	SEAT BELTS	EJECTE	NJURY		FIRST	AID BY
DES	123 M - Motorcycle	LAP BELT ONLY LAP & SHOULDER N - None Installed E - Nor Used	Y - Yes	A — Visible signs of injury, as bleeds distorted member, or had to be scene.	ng wound or carried from	P Police	D Other
CO	456 0-Other	F - Fastened G - Lap Selt Only U - Unfastened M - Both Belts Us	ed P – Family ed N – No	B — Other visible injury, as bruises, a swelling, limping, etc.	brasions,	A - Amb. Attend D - Doctor	N - None
	789 P - Pedestrian	D - Not Reported L - Not Reported	U - Unknow	 C — No visible injury but complaint momentary unconsciousness. 	Age Sex	Veh, Seat- Seat	Ejec In- First
	NAME Inlian D Stud	Ker P O Box 1905	AODRESS Dothan Al 3	6301	86 M	7 7 C	PIKN
MS	1 TAXENTO	snital Evergreen	Amoulance C	0.	point		1 1 1 1
U.	NAME NAME	Sproar Svergreen	ADORESS				
>	2 TAKEN TO		TAKENBY				
-	DIRECTION OF TRAVEL - V	EHICLE 1 - N ESW VEHICI	LEŻ-N E,S W	2.30 MILES N E SW.	то Еve	rgreen	
		See Diagram	on Page # 2				
		Dec Dragram	Un Tage // 2				
N							
SRA							
DIAC							
8							
IVE							
RAT							
ARI							
z							
	DESCRIBE WHAT HAPPEN	ED (REFER TO VEHICLES BY NUMBER)	Vehicle # 1	was traveling South	on T- 6	5 at a hig	h rate
	of speed. (Appro	ximately 100 to 110	Siles Per Ho	ur) The right rear	tire o	n vehicle	#]
	blew out. Vehicl	e # 1 traveled 600 fe	eet on the p	avement after the t	ire ble	w out leav	ring
	rubber on the pa	vement from the rupt	ured tire. A	t this point the dr	iver lo	st control	and
	skidded into the	grass median. Vehicl	le # 1 came	to rest up side dow	n,after	skidding	and
	overturning for	300 feat. The vehicle	e overturned	two and one half t	imes.		
	LIGHT WEATH	IER LOCALE	DEFECTS	CONSTRUCTION COND	TION	VISION OBS	CURED
IN	D-DAYLIGHT D-CLEAR	Circle Ones	A - SHOULDERS LOW	(Circle Cne For Each Vehicle) Circle Gne Fo 1 2 1 2	ir Each Ven.	Circle Crie For E	sch Ven.)
MEI	2 - DAWN 2 - CLOU 3 - DUSK 3 - RAINI	NG 3 - SHCP'G OR BUSINESS 4	3 - HOLES, BUMPS, ETC.	1 1 - ASPHALT 1 - DA 2 - CONCRETE 2 2 - W		01 - NOT OBS	CURED
NO	4 - DARKNESS 4 - FOG 5 - DARKNESS, RD. 5 - SNOW	ING 5 - SCHOOL or PLAY D 5 5	SURFACES 5 - ROAD UNDER CONST.	3 3 - BRICK 3 3 - SM 4 4 - DIRT 4 4 - M	JDOY	02 02 - RAIN, SM ON WINC	NOW, ICE, ETC.
VIR	LIGHTED SLEET 6 - HAILI	NG 6 - OTHER 7 7	5 - NONE 7 - OTHER	5 5 – OTHER 5 5 – HJ M.	ATERIAL	03 03 - TREES, 0 ETC.	CROPS, BUSHES,
EN	CHARACTER	TRAFFIC CONTROL	ROADWAY LANS	S ROADWAY DIVIDE	DBY:	04 04 - BUILDIN	G(S)
V 8	1 - Stringet - Level	2 (Circle One For Each Vendie) 1 1 - STOP SIGN 1 2 - STOP & CO SIGNAL 2	2 Gird's One For Facily Vi 1 - ONE LANE 2 - TWO LANES	tinle) MEDIAN CONSTRUCT 1 1 - CONCRETE 2 2 BOUCH SUBSACE	100	06 06 - SIGNBOA	ARD
M	3 3 - Straight - Up Grade 3 4 4 - Straight - Hillgrest 4	3 - YIELO SIGN 3 4 - OFFICER OR FLAGMAN	3 - THREE LANES	3 - EARTH 4 4 - PAINTED		07 07 - HILLCRE 08 08 - PARKED	VEHICLE(S)
OAL	5 5 - Curve - Level 5 6 6 - Curve - Down Grade 5	5 - RR CROSSING GATES 5 6 - RR FLASHING LIGHTS 6	5 - FIVE LANES 6 - SIX LANES OR MO	MEDIAN BARRIER 5 5 - CONCRETE	1	09 C9 - MOVING	VEHICLE(S) BY HEADLIGHTS
æ	7 7 - Curve - Up Grada	7 - NONE 7	7 - UNPAVED Any Wid	th) 6 6 - METAL COARDRA 7 7 - FENCE 8 3 - OTHER	1	11 11 - BUINDED	BY SUNLIGHT
and the second	the day of	E PUNCTIONING	SAL ONE WAY STREET	O AV MIDIAN	ī	3 13 - UNKNOW	N .
	None	CEDERAND VORTERSON CHARGED	UG N F	IBUTING CLECE/INST ANCE, S)	ONTRIBU	TING CIRCUN	ASTANCE(S)
Z	NONS NUMBER	NAME OF PERSON CHARGEO	CONTR	BUTING CIRCUMSTANCE(S)	10 – No Imprope 11 – Violations U 12 – Imp. Backin	ar Univing 26 – Wro Inknown 27 – Pass g 28 – Pass	ong Side of Road sing On H:N sing on Curve
ATIC	POLICE AGENCY NOTIFIED POL	ICE ARRIVED AMBULANCE ARRIVED	TRAFFIC FLOW RESTOR	Butch Adams	13 - Changing La 14 - Parking Imp 15 - Failum to O	roperty 30 - Tur im Lights 31 - Do	er Improper Passing ning Unlawfully
TIG.	NAME OF INVESTIGATING OFFICER	BADGE NUMBER		POLICE AGENCY	16 Lights Impro 17 Veh. Unsafe	Cond. 53 - Inat	s Stpd. School Bus ttention
/ES	NAME OF OTHER OFFICER(S) AT SCI	7U4 ENE BADGE NUMBERIS		A D I	18 - Oriving in W 19 - No Sig. Imp. 20 - Following T	oo Closely 36 – Ped	er ntoving Viol, c. Wt. Ht. Lt. Wh. Instrian Drunk
N	THE DATA ON THIS REPORT REFLE	TER, W.F. AIRKLAND 337	JEF COVERING THE ACCIO	A S T ENT, BUT NO WARRANT	21 - Defective Br 22 - Exceeding S 23 - Exceeding S	peed Limit 38 – Wal afe Speed 39 – Min	Ity Equipment king Violation
	IS MADE AS TO THE FACTUAL ACCU	JRACY THEREOF	- All.	DATE 06 129 171	24 - Disregard Sig 25 - No Right of	gn Sig. 40 – Rac Way 41 – Drin	ang On Hwy. v. under inf.
-	STO MALURE OF INVESTIGATING OF	HILER 1/LUP	Sellie	UATE: 00 1-7 114			

2.30 miles South to Eve:	rgreen			
		North		
	I- 65			
	Pa	aved Shoulder		
	Ó.₽	Right rear tire blew out he	P C	
	Pa	aved Shoulder		
	Gı	rass Median		
	Pa	aved Shoulder		
1	Pa	aved Shoulder		
Diagram Scale 1 inch = (20 feet) (10 feet)	Location Ir	aterstate # 65 .30 miles South to Evergreen in	. 10	A.M. (P.M.)
Signature of Reporting Officer(s)	Badge No.	Reporting Police Agency	DATE	
Sgt. J. T. Smelley	904	Alabama State Troopers 06	27	74



ATTACHMENT B



STATE OF ALABAMA DEPARTMENT OF PUBLIC SAFETY MONTGOMERY, ALABAMA 36102

August 27, 1974

LT. COLONEL C. W. RUSSELL ASSISTANT DIRECTOR

COLUMEL ELDRED & DOTHARD DIRECTOR OF PUBLIC SAFETY

MEMORANDUM

To: Staff

From: Lieutenant Harold Hammond

Sub: Tire Failure-Perry County, Florida Sheriff's Office

As a result of a news article found in the August 8, 1974 issue of the Perry News-Herald reporting the death of Taylor County Deputy Sheriff Victor J. MacDonald on Sunday August 4, 1974, Cheriff Maurice Linton was contacted for further details (Area acode: 904 - 584-4225)

According to reports, Deputy MacDonald was out of his patrol vehicle at a service station when a speeding car went by on US-19. The deputy ran to his patrol car and pursued the car at speeds in excess of 100 MPH. The road was wet during the pursuit but no rain was falling at the time. Sheriff Linton reported that the tread on the right rear tire separated from the body of the tire and "rolled into a ball". The tire was a foodyear steelward Tradiel and had been mounted on the patrol car on July 26, 1974. The sheriff estimated that the tire had dess than 2,000 miles on it at the time of the failure. The sheriff said a combination rollbar and shield kept the car's top up even though the car overturned several times. He was of the opinion that the deputy would have lived if he had fastened his seatbelt and remained in the car. He stated the department planned no action against Goodyear Tire and Rubber Company but he believed the deputy's family planned legal proceedings.

An insurance adjustor had attempted to secure the tire which failed for the purpose of returning it to Goodyear for tests. Instead the sheriff has released the tire to the *whorida Highway Patrol* with the understanding that they permit an independent laboratory to inspect it and issue a report.

The sheriff was unable to advise how many Goodyear tires were in service on the wrecked vehicle and also he stated his department had no entablished regulation governing tire eir pressure. The amount of air pressure required is determined by the driver of the vehicle.

HJH/ggb

'Skip' MacDonald Dies In Crash Sunday Night

Taylor County Deputy Sheriff Victor J. "Skip" MacDonald died instantly of head injuries received Sunday evening when his patrol car overturned after blowing a tire as the deputy pursued a speeding motorist at more than 100 miles per hour on US 19 south of Salem.

Witnesses said MacDonald was at a service station in the area when the speeding vehicle went by and that he hurried to his parked cruiser to give chase. The blowout was caused, it was reported, by separation of the tread of a rear tire. Sheriff Maurice Lanton said Monday that the tire in question had been put on the car only about two weeks before the accident and that he was unable to understand its failure.

MacDonald's car turned over several times it was reported. The officer died instantly of "massive head injuries" it was reported.

MICHELIN ROADABILITY TEST

On April 3, 1968, handling tests were conducted with two 1966 Dodge Class A vehicles equipped with the Michelin Radial Tires. One vehicle had zero camber; the other negative. The testing location consisted of turns of varying radii and corresponding speeds.

Testing began with air pressures of 36 p.s.i. At approximately 20 miles of testing, tread chunking at the outer edges of the front tires appeared. With both camber settings, there was an extreme understeer characteristic until cornering forces became such to cause the tire to roll upon the sidewall. At this point, extreme oversteer took place.

Air pressures were reduced to manufacturers recommendation of 27 p.s.i. and testing duplicated. Handling was the same as with the higher pressures except that the lag between understeer and oversteer was shorter.

With both air pressures at speeds of 90 to 100 m.p.h., the tires caused a lateral oscillating effect.

Tire spin on acceleration in tight turns was minimal indicating good rectilinear cohesion.

At the conclusion of testing, an inspection of the tires indicated excessive tire tread "chunking" and sidewall wear.

AUTHOR'S NOTE:

The model of tire used in these 1968 tests are no longer in production, according to the Michelin Corp. Current model Michelin standard grade, steel belted radial tires were included in the DOT tests summarized in Table la.



Training Division

October 9, 1973

31.2678.A1418

FIRESTONE RADIAL TIRES

Academy

As instructed, the Academy has completed testing of Firestone steel radial tires.

The tires, two sets of HR 78-15 Steel Belt Radial 500's and one set of HR 70-15 Steel Belt Radial V1's, have been returned to Motor Transport Section.

All testing was conducted on the Academy high speed course in the presence of Mr. F. W. Weller, Firestone Tire and Rubber Company. Prior to testing, each set of tires was driven a minimum of 50 break in miles at normal highway speeds.

The results of our tests are as follows:

Firestone Steel Radial 500-HR 78-15

Testing was conducted on September 26, 1973. The tire is 4 ply (2 polyester - 2 steel) with 2 ply polyester side walls. Tire pressures were at factory specification - 32 p.s.i.

The handling characteristics of the tires were erratic with predominant understeer. This is typical with radial tires during hard cornering. Chunking occured at the outer shoulder of the right front tire after 14 miles of testing.

Firestone Steel Radial V-1-HR 70-15

Testing was conducted on October 1, 1973. The tire is 7 ply (6 rayon - 1 steel) with 2 ply rayon side walls. Tire pressures were at factory specification - 32 p.s.i.

The handling characteristics were typically erratic with radial tires although improving with wear. The tires were testrd for 40 miles without the presence of abnormal wear or failure. Testing was terminated with the appearance of a chunking about the size of a quarter on the right front tire. This was probably caused by a stone cut, but could be a separation at the tire splice point. The tire is far superior to other radial tires tested by our staff to date. Training Division Page 2 October 9, 1973

Firestone Steel Radial 500-HR 78-15

Testing was conducted on October 4, 1973. The tire is identical to the steel radial 500 tested on September 25, 1973. Tire pressure was increased to 36 p.s.i. for this test.

Handling characteristics were the same as previous tests. Chunking appeared after 10 miles.

Attached are photographs taken of the tires after testing.

H. D. FARGO, Captain Commander

Enclosure



Academy

July 24, 1973

31.6176.A2820

PIRELLI CINTURATO CN 75 RADIAL TIRE TEST

Skill Development Unit

On July 17 and 19, 1973, the E.V.O.C. staff conducted a series of tests designed to evaluate the handling characteristics and durability of the Pirelli Cinturato CN 75 radial tire. The tire is a 4 ply tread, 2 rayon, 2 steel, with 2 ply, rayon sidewall.

The tires used in the evaluation were mounted on a 1972 Dodge Polara, (B8655) assigned to the Academy E.V.O.C. unit as a high speed training vehicle. The tires were mounted by Jack's Shell and the front end aligned by Swift Dodge to specifications requested by the Bruces Tire Company.

After 60 miles of street driving the tires were subjected to high speed testing on the E.V.O.C. course. Twelve laps were completed counterclockwise. The first 5 laps were at moderate speeds with the last 7 laps at high speeds. At the completion of the 12th lap (18 miles) the right front tire was warped to the point of being unusable. The right front tire was replaced and testing continued. At the end of 13-1/2 laps clockwise the entire tread peeled off the casing of the left front tire. This occurred as the vehicle entered a constant radius turn to the right at a speed of 100 mph. The tire failure caused the vehicle to leave the roadway at this point. Total mileage on the 5 tires was 120 miles.

The tires were inflated to 36 p.s.i. as specified by Bruces Tire Company. The handling characteristics were completely unsuitable for enforcement driving purposes. If moderate to hard acceleration was attempted while hard cornering, excessive understeer occurred. If no acceleration was attempted an exaggerated oversteer was present.

Although one tire warped and another separated, it was noted that no chunking of the outer tread was present, as has been the case with some previous radial tires tested. Academy Page 2 July 24, 1973

The consensus of the two test drivers is that the Pirelli Cinturato CN 75 radial tire is unpredictable performancewise and lacks the durability to be effective on enforcement vehicles.

J. R. McDANIEL, I.D. #6176 State Traffic Officer





Department Of HIGHWAY SAFETY AND MOTOR

State of Florida

HIGHWAY SAFETY AND MOTOR VEHICLES

COL. REID CLIFTON, DIRECTOR DIVISION DE ELDRIDA HIGHWAY PA-NEIL KIRKMAN BLDG.

JOHN D. CALVIN, DIRECTOR DIVISION OF MOTOR VEHICLES COLLINS BLDG. ... 107 W. GAINES ST.

CLAY W. KEITH, DIRECTOR DIVISION OF DRIVER LICENSES NEIL KIRKMAN BLDG.

AUDRY CARTER, JR., DIRECTOR DIVISION OF ADMINISTRATIVE SERVICES NEIL KIRKMAN BLDG.

RALPH DAVIS EXECUTIVE DIRECTOR NEIL KIRKMAN BLDG. TALLAHASSEE 32304 FLORIDA HIGHWAY PATROL P. O. Box 332 Lake City, Florida 28 September 1973

SUBJECT: Accident Involving Trooper T. L. Sullivan -FHP-1047 - 9/24/73

TO: Colonel J. E. Beach, Director

ATTENTION: Major W. R. Kaufman

Please find attached complete investigation by Sergeant T. A. Pace on an accident involving Trooper T. L. Sullivan while operating FHP-1047.

Trooper Sullivan was responding to a call to assist Trooper R. W. Aderholt who had received a "hit" on an automobile from NCIC and this car was occupied by five runaways. Trooper Sullivan was proceeding south on SR-93 at approximately 100 MPH when his left rear tire, Firestone Steel Belted Radial HR-70 completely separated from the tread but did not lose all its air, causing Trooper Sullivan to lose control. He skidded sideways through the median strip, across two northbound lanes, at the emergency strip started turning over and turned over four times, coming to rest upon a fence against a small tree on his side, driver's side down. Trooper Sullivan has a broken right leg and is now confined to the Alachua General Hospital and in all probability will be off about three months.

I personally went to the scene before Trooper Sullivan was placed in the ambulance and observed all the evidence at the scene and it is my opinion that the entire cause of the accident was the Firestone tire separating at high speed.

FHP-1047 was a total loss and attached find three bids for salvage and I recommend we accept Mott Chrysler Plymouth, Inc. Live Oak, Florida, bid for \$300.00 for this wrecked vehicle.

We have not received a written statement from Trooper Sullivan because of his injury but will get one 28 September 1973

Accident Involving Trooper T. L. Sullivan - FHP-1047 - 9/24/73

when he is able and a homicide report will follow.

As Trooper Sullivan was enroute to assist another trooper in the performance of his duties, I do not feel he was negligent and recommend no disciplinary action whatsoever.

T. C. Hodan

T. C. Hodges, Captain Commander - Troop B

TCH/fg

Encls.

ATTACHMENT D-2

State of Florida

TALLAHASSEE 32304

QL

COL. REID CLIFTON, DIRECTOR DIVISION DF FLORIDA HIGHWAY PATROL NEIL KIRKMAN BLOG.

CLAY W. KEITH, DIRECTOR DIVISION OF ORIVER LICENSES NEIL KIRKMAN BLDG.

AUDRY CARTER, JR., OIRECTOR OIVISION OF AOMINISTRATIVE SERVICES NEIL KIRKMAN BLOG.

RALPH DAVIS EXECUTIVE DIRECTOR NEIL KIRKMAN BLDG.

FLORIDA HIGHWAY PATROL P.O. Box 332 Lake City, Florida 25 September 1973

HIGHWAY SAFETY AND MOTOR VEHICLES

SUBJECT: Accident involving FHP # 1047 Trooper T. L. Sullivan, ID # 586

TO: Captain T. C. Hodges

Department Of

VIA: Lieutenant J. E. Love

On Monday, 9/24/73, at approximately 7:45 A.M., I was advised that Trooper T. L. Sullivan had been involved in an automobile accident. Upon arriving on the scene and completeing an investigation of the accident, I found the following had occurred.

Trooper R. W. Aderholt requested the FHP Station to check for wanted on a Georgia tag, LAR715. The Station advised Trooper Aderholt the car was wanted and should be occupied by several runaways.

Trooper Sullivan, upon hearing this radio transmission, advised the Station that he was enroute to assist Trooper Aderholt. Trooper Sullivan was proceeding south on SR # 93 (I-75) at a high rate of speed when the left rear tire on FHP 1047 completely separated, causing Trooper Sullivan to lose control of his vehicle. Trooper Sullivan skidded across the median and north bound lanes of SR # 93, before turning over four times.

My investigation revealed that while speed was a factor, the major cause of this accident was a defective tire.

Due to Trooper Sullivan responding to a call for assistance from Trooper Aderholt, I do not feel he was negligent in any way.

J.a. Vace

T. A. Pace, Sergeant Troop B - Lake City

TAP/da

AT	TAG	СНМ	ENT	D-3
				0 0

	FLORIDA TO AFFIC ACCIDENT MAIL TO ACCIDENT RECORDS JOINT OF HIGHWAY SAFETY & MOTOR VEHICLES, TALLAR	REP	OR 1	
	9/24/73 Nonday 7:45 A.	м		
Z	Columbia Columbia			
CATIC	The second state is a second state with the second state of the se			
LO N	$\begin{array}{c c c c c c c c c c c c c c c c c c c $			
ME	Use State of County Road further of Name Feel			
F	AT IMPER 2.9 Males N S E W Df Show nearest mitpost, intersecting stied or highway, hidge, RR clossing, underpa	ss of curve		
	TYO GVERTURS AND X OTHER NURCOLLISIUM PLBESTRIAN INVITE TRANSPORT INVITED	THER ROADAAY	HIT AND	SPACE ABOVE
VEHICL	E ACCIDENT TARALO VV SALBAY TRADI FEDALOSEUST AUVAL FIXED OBJECT (OTHER OBJECT	SO'L CON	TACT
TUTAL	VEAL VARE TYPE ISedan, Truck, Kiss, etc.) VEHICLE LILEISE PLATE NO. STATE YEAR	DELLA LT	TELCATION NO	10
VEH	Avaid Venuel 2 5 Damage 3 Dimage 3 25 CO O CO	REMOVED BY)12149	D Ju
VOLVED	Currage L.2 Scale Sevenity Source is a sevenity Source isevenity Source is a sevenity	Les Pa Requesi	INC &	BOD Y alion List
. [⊥]	Pacific Indemnity IAC9808-92-99 Diver Diver Diver Diver Diver I Other (E ORVER (Fund or lyce FULL name) ADDRESST Number and street)	xplain) Cli	FY and STATE	
	Florida Highway Patrol Neil Kirkman Bldg,, Tallahass	ee, Fl	orida	
	Timothy Leonard Sullivan Rt. 6 Box 678, Lake City, Fl	orida	32055	Fred Llewry
-	Trooper Type Op S41581241344722 Fla. BRTH 9/24	/41 W	M 1	0 2
ICLE	Front center None	AUE NACE	SEX Salely E	. Ejeci, inju/y
VEH	Frant right	AGE RACE	SEX Safely E.	Elect, Eigury
	Sear left	AGE RACE	SEX Safety E	Eject Injury
	Rear center	AGE RACE	SEX Salety E	Eject. Injury
	Ren uphi	AGE RACE	SEX Safety E.	Eject, Injøry
	YEAR MAKE TYPE (Sedan, Truck, Bus, elc.) VEHICLE LICENSE PLATE NO STATE YEAR	VEHICLE IDEN	TIFICATION NO.	
	Area of Damage Damage AMDUNT (Approximate) Safety VEHICLE	REMOVEO BY		
	Q1-2ge Scale Sevenity ment NAME OF HISURANCE (Liability Only) PDLICY NO. Owner Onner*	s Request	Rot	alion List
Z	Diver	Explain) CIT	Y and STATE	
STR!	DRIVER (Exactly as on driver's license) ADDRESS (Number and slire)	C(1	Y and STATE	
PEDE	UCCUPATION Driver'S DRIVER'S LICENSE NUMBER STATE DATE Month, Day, Ye	ai) RACE	SEX Sately E	Eject Injuty
- o	License OF BIRTH OCCUPANTS Name ADDRESS - (Number and Street) City and State	AGE RACE	SEX Safety E.	Eject. Injuly
CLE 3	Fishl center	ACE RACE	SEX Safely E	Fiert linuty
/EHI0	Etonl ugh	AGE RACE	SEX Sately F	Eject Inion
	Sear left	ACE PACE	SEX Safety E	Fierl Januty
	Rear conter	AGE RACE	SEX Salety E.	Ejeci Injuly
	for v right			
Per La Constantia de la	ace 50.00 F23. Dent. Of Transportation. Is	ake Cit	STATE	
IN VESTIG/	ATUR More and Lank (Signature)		C.P.O.	9/21L/
	Sergerno X. W. Jack 5-97 121 FHP	S.U	j Uther	71 6.11

SR # 93 Northbound Med Yan SR # 93 Southbound		HIGICAT LE 1-35111 ATTH ARE' A THARE' A POINT OF MIRACI TALL. A Right Loon Left side Rea Right rear Left near
Vehicle # 1 traveling south on SR # 93 at a high	n rate of	f sneed.
The left rear tire came apart causing the driver to lo	se conti	rol.
Vehicle # 1 skidded 295' across median, 100' more acro	ss north	nbound
lanes of SR # 93 and then 196 turning over four times	and car	ne
to rest on left side heading east.		
VEHICLE DEFECTS: Defective Tires.		
WHAT VEHICLES WERE DOING BEFORE ACCIDENT VEHICLE No. 1 was fraveling 20 00 00 SR 93 at 100 Approximately M.P.H.	DRIVERS	AND VEHICLES
VEHICLE No 2 was have in a line in the Hermitian Andrew State in t		
	VE	HICLE 1 VEHICLE 2
Very e Very e Very e Very e 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 3 1 2 1 2	PHYSICAL OEFECTS (Onver)	HICLE 1 VEHICLE 2
Verve Verve 1 2 Verve 1 1 2 1 2 1 2 1 3 1 4 1 4 1 5 1 5 1 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2	PHYSICAL CEFECTS (Oliver)	
Versice Versice 1 2 Versice Versice 1 2 1 2 1 2 Going straight ahead Making right turn Stowing or Stopping Stopped or parked Overtaking Making left turn Changing tancs Other (explein above) • VYHAT PEDES TRIAN WAS DOING Along Cotor of Clothing PEDESTRIAN was going Across or mlo form	VEHICLE	
Vence Vehicle 1 2 1 2 1 2 1 2 1 2 1 3 1 2 1 2 1 3 Starting from parked position 1 2 1 2 1 3 Starting from parked position 1 0 0 0 1 1 2 1 3 Starting from parked position 0 0 Vencle 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0<	VEHICLE OEFECTS	NICLE 1 VEHICLE 2
Verve Vehicle Vehicle 1 Venicle Vehicle 1 2 1 2 1 2 1 2 1 2 1 2 3 1 2 1 2 1 4 1 2 1 2 1 4 1 2 1 2 1 4 1 2 1 2 1 4 1 2 1 2 1 2 4 1 2 1 2 1 2 1 4 0 Making right luin 1 2 1 1 2 0 Veriaking Making right luin 1 2 1 2 1 2 • WHAT PEDESTRIAN WAS DOING Along Along Color of Clothing Color of Clothing 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 <td>VEHICLE CONTRI- BUTING CONTRI- CONTRI- BUTING CONTRI-</td> <td>HICLE 1 VEHICLE 2 D 16 1</td>	VEHICLE CONTRI- BUTING CONTRI- CONTRI- BUTING CONTRI-	HICLE 1 VEHICLE 2 D 16 1
Verve Vehicle 1 2 Verve 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 1 1 2 1 1 2 1 1 2 1 1 2 1 1 2 1 1 2 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1<	VE PHYSICAL OEFECTS (0 VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES	
Vence Vehicle Vehicle 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 <td>VE VE PITYSICAL OFFCTS OFFCTS OFFCTS VEHICLE OFFCTS OEFECTS OFFCTS CONTRI- BUTING OFFCTS CIRCUM- STANCES OFFCTS CLASS OF TRAFFICM TYPE TRAFFICMAY</td> <td>HICLE 1 VEHICLE 2 D HICLE 1 HICLE 2 HI</td>	VE VE PITYSICAL OFFCTS OFFCTS OFFCTS VEHICLE OFFCTS OEFECTS OFFCTS CONTRI- BUTING OFFCTS CIRCUM- STANCES OFFCTS CLASS OF TRAFFICM TYPE TRAFFICMAY	HICLE 1 VEHICLE 2 D HICLE 1 HICLE 2 HI
Vence Vehicle Vehicle 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 Going straight ahead 1 Making right fuin 1 2 1 1 2 0 Overfaking 1 Along Color of Clothing 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VE VERICLE OEFECTS CONTRI- OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICMAY	HICLE 1 VEHICLE 2 D 16 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
Venicle Venicle 1 2 Venicle 1 2 1 2 Image: Statistic state 1 2 1 2 Image: Statistic state 1 2 1 2 1 Image: Statistic state 1 2 1 2 1 1 Image: Statistic state 1 1 2 1 2 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 <td< td=""><td>VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICKAY</td><td>HICLE 1 VEHICLE 2 D 16 1 Avs 1 1 1 1 1 1 1 1 1 1 1 1 1 1</td></td<>	VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICKAY	HICLE 1 VEHICLE 2 D 16 1 Avs 1 1 1 1 1 1 1 1 1 1 1 1 1 1
Vence Vehicle 1 2 Vence Vehicle 1 2 1 1 2 1 2 1 1 2 1 2 1 1 1 2 1 2 1 2 1 1 2 1 2 1 2 1 1 1 2 1 2 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICM TYPE TRAFFICMAY	HICLE 1 VEHICLE 2 D 16 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
Venice Venice Venice 1 2 1 2 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICM TYPE TRAFFICMAY	HICLE 1 VEHICLE 2 D I I I I I I I I I I I I I I I I I I
Venice Venice Venice 1 2 1 2 1 2 1 1 2 1 2 1 2 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICM TYPE TRAFFICMAY CLASS OF TRAFFICMAY CLASS OF TRAFFICMAY TYPE TRAFFICMAY	HICLE 1 VEHICLE 2
Venete Venete 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 <td< td=""><td>VE VERICLE () OEFECTS () VEHICLE () OEFECTS () OEFECTS () CONTRI- BUTING () CIRCUM- STANCES () CLASS OF TRAFFICMAY STANCES CLASS OF TRAFFICMAY STANCES CIRCUM- STANCES CIRCUM- STANCE</td><td>HICLE 1 VEHICLE 2</td></td<>	VE VERICLE () OEFECTS () VEHICLE () OEFECTS () OEFECTS () CONTRI- BUTING () CIRCUM- STANCES () CLASS OF TRAFFICMAY STANCES CLASS OF TRAFFICMAY STANCES CIRCUM- STANCES CIRCUM- STANCE	HICLE 1 VEHICLE 2
Venicle Venicle 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 1 2 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VEHICLE OEFECTS VEHICLE OEFECTS CONTRI- BUTING CIRCUM- STANCES CLASS OF TRAFFICK TYPE TRAFFICKAY CLASS OF TRAFFICKAY CLASS OF TRAFFICKAY CLASS OF TRAFFICKAY TYPE TRAFFICKAY TYPE TRAFFICKAY CHEMICAL TFST. YES Driver No. 1	

ARMSTRONG RUBBER COMPANY

EXECUTIVE OFFICES 500 SARGENT DRIVE NEW HAVEN, CONNECTICUT

INTER-OFFICE CORRESPONDENCE

FROM A. R. Colborne

TO F. L. Palmieri

DATE April 2, 1975

SUBJECT G70-15 Load Range B High Speed Pursuit 70 Testing Data сору то T.C. Fritz, Jr. E.J. Doyle T.J. Hughes

The G70-15 High Speed Pursuit 70 in a 4 ply nylon construction was tested on Armstrong's extended version of the FMVSS 109 stepped high speed wheel test.

Each of three tires tested achieved 1/2 Hr. @ 125 MPH without failure.

The wheel test conditions were as follows:

- 1) 30 PSI cold inflation pressure at start of test.
- 2) Constant 1,380 Lbs. Load throughout test.
- 3) Wheel room temperature of 100°F.

4) Speeds:

1 HR. @ 50 MPH (Break-In) 1/2 HR. @ 75 MPH 1/2 HR. @ 80 MPH 1/2 HR. @ 85 MPH FMVSS 109

FMVSS 109 Minimum Then increase the speed 5 MPH for each succeeding half hour test increment.

I would like to add that in any comparison between indoor wheel and road high speed testing, the wheel testing must be considered, by far, the most severe due to the high ambient temperature required and lack of air circulation.

Outdoor track testing is forthcoming and these results will be forwarded to you upon receipt.

a.R. Collonne

A. R. Colborne Project Engineer, Research & Development

ARC:e1

ATTACHMENT E-2

A WORLD ORGANIZATION



ID TINTIGOLD

EXECUTIVE OFFICES: BOX 1109, BUFFALO, NEW YORK 14240, 716 - 877-2200, TELEX 9-1240

June 4, 1975

Mr. Jared J. Collard Standards Lab National Bureau of Standards Washington, D. C. 20234

Dear Mr. Collard:

Enclosed is the certificate of Dunlop Elite RS Radial Patrol tire and specifications. This letter and the information attached has been sent to the various state agencies interested in this tire.

We also have a G78-15 and H78-15 nylon 4 ply Dunlop RS Patrol certified for 125 miles per hour of sustained speeds.

If any other information is necessary, please contact me.

Very truly yours,

DUNLOP TIRE AND RUBBER CORPORATION

mabl

B. P. Klyza, Assistant to the Senior Vice President

BPK/bb

Encls.

CERTIFICATION OF TESTING AND TEST RESULTS

COPY

STATE OF TEXAS X

COUNTY OF REEVES X

That on this 16th day of July, 1974, personally appeared before me, a Notary Public, in and for said County and State, VICTOR F. SPRINGER, known to me to be the President of the Corporation that executed the foregoing instrument, who upon oath did depose that he is the Officer of said Corporation as above designated; that he is acquainted with the seal of said Corporation and that the seal affixed to said instrument is the Corporation seal of said Corporation; that the signature to said instrument was made by the Officer of said Corporation as indicated after said signature; that the same Corporation execued the said instrument freely and voluntarily and for the uses and purposes therein mentioned.

IN WITNESS WHEREOF, I have hereunto set my hand and affixed my official seal the day and year in this certificate first above mentioned.

SEAL

(signature) LETHA E. COATS, NOTARY PUBLIC IN AND FOR REEVES COUNTY, TEXAS COPY

AUTOMOTIVE PROVING GROUNDS, INC.

P. O. Box 109 Phone 445-5092

Pecos, Texas 79772

I hereby certify that the tests reported below were conducted at Automotive Proving Grounds Incorporated on July 13, 1974.

Tires were two (2) Dunlop Radial HR78-15, Identified as EAVYAA 1204, Numbers Bl & B2.

Tests were conducted under the following conditions:

- Test tires on two front wheels of vehicles 1.
- 2. Cold Inflation 30 psi
- 3. Load 1510 lbs per tire
- 4. Rim 6.50 JJ
- Test Surface Automotive Proving Grounds High Speed Track
 Break-in 54 miles @ 60 MPH
 Test 54 miles @ 90 MPH
- - 54 miles @ 105 MPH
 - 54 miles @ 115 MPH
 - 50 miles @ 125 MPH

The test was conducted under the above conditions on the (9) nine mile asphalt test track located at Automotive Proving Grounds, Incorporated, Pecos, Texas.

This track was built for testing of tires and was constructed to simulate turnpike conditions.

At the end of the test, the tires were inspected and no visable defects or failures of any nature could be found.

Ambient temperature for the tests was 73°F at start and 81°F at finish.

The tachograph chart made during the test is attached.

SEAL

Signed: (Signature, Victor F. Springer, President





April 1, 1975

Mr. Jared J. Collard, Acting Mgr. Police Vehicle Frograms Law Enforcement Stds. Laboratory Room B-150, Physics Building National Bureau of Standards Washington, D.C. 20234

Dear Mr. Collard:

Our Washington Office has referred your inquiry concerning the sizes and types of tires which Firestone has certified as suitable for high speed patrol and pursuit tire application to us. These are listed below. Those sizes and types listed in Group 1 were sent to you attached to my letter of January 23, 1975. Group 2 lists additional sizes and types certified for this usage since my letter and Group 3 lists additional sizes which are in process of being tested. The latter will be certified when successful tests are completed.

Group 1.	<u>Size</u>	Descripti	on	<u>Cord Materials</u>
	HR78-15	Super 500	Radial Tubeless	Polyester/Kevlar
	G78-15	Super 500) Sup-R-Belt	Polyester/Fiberglass
	H78-15	Super 500 Tubeless) Sup-R-Belt	Polyester/ ^r iberglass
	G78-15	Super 500) Nylon Tubeless	Nylon
	H78-15	Super 500) Nylon Tubeless	Nylon
	J78-15	Super 500) Nylon Tubeless	Nylon
Group 2.	HR78-15	Super 129	5 Radial Tubeless	Polyester/Kevlar
	JR78-15	Super 129	5 Radial Tubeless	Polyester/Kevlar
	GR70-15	Super 129	5 Radial Tubeless	Polyester/Kevlar
	G78-15	Super 125	ó Nylon Tubeless	Nylon
	H78-15	Super 125	ó Nylon Tubeless	Nylon
Group 3.	FR70-14	Super 12	5 Radial Tubeless	Polyester/Kevlar
	HR70-15	Super 12	5 Radial Tubeless	Polyester/Kevlar
	LR78-15	Super 12	5 Radial Tubeless	Polyester/Kevlar

The Super 125 Radial line has recently been announced. Attached is a news release covering this line.

Very truly yours.

A. J. DiMaggio QUALITY ASSURANCE

AJD:g att.





RECEIVED

APR 1 4 1975 A. J. DIMAGGIO

April 10, 1975

FIRESTONE DEALERS AND STORES:

SUBJECT: USE OF NORMAL RADIAL PASSENGER CAR TIRES AS HIGH SPEED "PURSUIT" TIRES

The National Highway Traffic Safety Administration and the Law Enforcement Assistance Administration have recently cautioned against the dangerous practice of some highway patrol police organizations using normal radial passenger car tires in extra-legal high speed "pursuit" driving. Firestone concurs in this caution and re-emphasizes the following to its stores and dealers who sell tires to local governmental organizations.

Most tires procured by government agencies will be used in normal passenger car service. In such case, our Steel Radial 500 tire represents the most economical all-purpose tire for this application. However, the Steel Radial 500 is not a "pursuit" tire. In the interest of safety, it should be confined to speeds under 100 mph where permitted by local law. When used at extra-legal speeds, it is imperative that cold tire inflation pressures be maintained daily at 32 PSI.

Emergency vehicles, such as highway patrol police vehicles which are customarily required to drive at speeds in the 100 mph to 125 mph range, should always be equipped with manufacturer's certified "pursuit" tires. The following three (3) tires are certified by Firestone as "pursuit" tires and should be used exclusively in such application:

Super	125	Nylon	(Previously	Super	500	Nylon)
Super	125	Radial	(Previously	Super	500	Radial)
Super	500	SRB	(Now discon	tinued)	

As it is impossible to know whether tires sold to police organizations will be mounted on vehicles employed in routine police service, or as extra-high speed "pursuit" vehicles, we have advised all stores and dealers that effective January 21, 1975, they may sell only manufacturer's certified "pursuit" tires to police organizations.

Special attention should be given to cases in which the procurement is of a general nature, but there is a possibility that some of the tires procured will or may be used on police pursuit or other emergency vehicles. In such cases, the above information should be carefully reviewed with the governmental procurement office or purchasing agent with a view to obtaining the correct tire for the specific use or application intended.

(over)

33

Customers who have purchased radial passenger car tires for a use which may not be proper under the above guidelines should be contacted and advised to remove such tires from emergency vehicles and place them on normal passenger service vehicles belonging to their organization. You should then attempt to sell them one of the two Super 125 "pursuit" tires listed above for emergency vehicles use. You should also reemphasize to all of your customers the necessity of daily maintenance of cold tire inflation pressures at 32 PSI for driving at extra-legal speeds. This will be particularly critical during the forthcoming Summer months.

If you have any questions on the above, please contact your district manager or district truck tire manager.

THE FIRESTONE TIRE & RUBBER COMPANY

ATTACHMENT E-4

AREA Area Mktg Director Mgr. Area Admin Sup. Retread Service

Arch & Const. Sup

Sup Retail Service

REGIONS Regional Mgr Dist. Mgr -Fran. SIs.

Dist. Mgr.-Retail SIs.

Mgr Reg Sts. Admin.

Mgr Franchise Sts.

Contr. Tire Men Class 1 BFGS

Class 2 BFGS

Leased Dept.

Sup Pl. BFGS Comm'l Salesmen Retread Ptants BFGS – B&W Depts

Reg Acctig

F 405

410

BFG

Whiser

AAH DLRS. GENERAL Cust Rel.& Prod Ser Cr. Mgrs. & Sup. Field Auditors Whse. S.S. Mgrs

Mgr Direct Sts. Sup. Fteet Sts. Spec. Contr. Repr Sup Mileage Sales

Oit Co. Personnel As Specified

Akron List

A B

Associate BAT. DLRS.

TIRE DLRS.

X Max

F

I PR

DELCO

RP-25

7A-20

Leased Dept. Sup



VERY IMPORTANT -- READ IMMEDIATELY!



Bulletin No. #PP74-65 Dete 7-31-74

B.F.GOODRICH TIRE COMPANY RECOMMENDS PURSUIT RADIAL, STOCK SERIES 302, FOR USE ON ALL TYPE POLICE VEHICLES

B.F.Goodrich Tire Company manufactures three sizes of Pursuit Radial Tires: Sizes GR, HR, and JR70-15. These tires are constructed of rayon belts and carcasses and have been tested and certified to be capable of driving up to 125 MPH.

B.F.Goodrich Tire Company strongly recommends that no other tire, bias, bias belted or radial steel, be offered for use on Police vehicles where the operator could be caused to drive that vehicle in excess of 100 MPH.

> W. A. Kester, Director of Field Sales

wb

TAKE FOLLOWING ACTION

1. File in P&PM

2. Keep until Revised

3. File in your_____ Menual Passenger Section After____ Page

4. Remove from_

__the following:____

BFG-4864 7/74

B.F.Goodrich Tire Company e Division of The B.F.Goodrich Company

LITHO. IN U.S.A.



VERY IMPORTANT - READ IMMEDIATELYI

BULLETIN

Bulletin No. GI-75-22 Date March 20, 1975

Government warns police: Use only high speed tires on pursuit vechicles

Steel belted radial passenger tires recently received national news coverage when statements were issued by both the Department of Justice and the Department of Transportation. Highlights of the statements are as follows:

- A number of accidents, including two fatalities, have recently resulted when steel belted radials failed during pursuit in excess of 90 miles per hour. (No B.F.Goodrich tires are involved.)
- Police agencies should purchase only tires designed for high speed pursuit for patrol vehicles that exceed 90 miles per hour.
- 3. Steel belted radials, in consumer use, "provide superior performance in many aspects of vehicle handling and tire durability."

B.F.Goodrich Recommendation

The B.F.Goodrich recommendation was originally stated in Product and Price Bulletin 74-65 sent to all retailers in mid-1974. This recommendation is emphasized as follows:

"B.F.Goodrich Tire Company manufactures three sizes of Pursuit Radial Tires (stock series 302-): sizes GR, HR, and JR 70-15. These tires are constructed of rayon belts and carcasses and have been tested and certified to be capable of driving up to 125 mph."

"B.F.Goodrich Tire Company <u>strongly</u> recommends that no other tire, bias, bias belted, or radial steel, be offered for use on police vehicles where the operator could be caused to drive that vehicle in excess of 90 mph."

								B.F.Goodrich Tire Company											
T	A	К	E	F	0		L	0	W		N	G	A	С	T		0	N	
		1	Product	3 -	Pric	0 M.	2 73 1 1 /	.1					furth	0r 7	oti	~ ~			

T. File in	2. Keep until Turther hourse.
3. File in your	Manual Section After Page
4. Remove from	the following:
BFG-4864 12/74	B.F.Goodrich Tire Company a Division of The B.F.Goodrich Company

AREA						
x	Area Mktg. D	rector				
x	Mgr. Area Ad	min.				
x	Sup. Retread	Service				
x	Arch. & Cons	t. Sup.				
x	Sup. Retail Se	ervice				
	REGIO	NS .				
x	Regional Mgr					
x	Dist. MgrFra	in. Sis.				
x	Dist. MgrRe	tail SIs.				
x	Mgr. Reg. Sis	Admin.				
x	Mgr. Franchis	e Sis.				
x	Contr. Tire Me	en				
x	Class 1 BFGS					
x	Class 2 8FGS					
x	Leased Dept	Sup.				
x	Leased Dept					
	Sup. Pt. BFGS	5				
x	Comm'l Sales	men				
x	Retread Plant	s				
	8FGS-B&W Depts					
x	Reg. Acct'g					
TIRE DLRS.						
x	Кеу	PR				
x	Net	1				
	Other					
	BAT. D	LRS.				
	BFG DI	ELCO				
	A	7A-30				
	В	RP-25				
	Whiser	7A-20				
	ASH DL	RS.				
	GENER	AL				
x	Mgr. Mkt De	vel				
x	Cust. Rel. & P	rod Ser.				
x	Cr. Mgrs. & Sup					
x	Field Auditors					
x	Whse SS M	grs				
x	Mgr Direct S	Is				
x	Sup Fleet Sis					
x	Spec Contr F	Repr				
x	Sup Mileage	Sales				
**	Cil Co Persor	mel				
	As Specified					
X	Akron List					

LITHO. IN U.S.A.

The Goodyear Tire & Rubber Company

Akron, Ohio 44316

June 5, 1975

United States Department of Commerce National Bureau of Standards Washington, DC 20234

Attention: Jared J Collard, Acting Manager Police Vehicle Program Law Enforcement Standards Laboratory

> Subject: High Speed Tires for Police Vehicles

Gentlemen:

In reply to your letter of May 30, 1975 to Mr J W Timmons of our company, we are furnishing the information requested on police tires manufactured by Goodyear.

Following is a list of available police tires which, at this time, we have tested and certified up to a minimum speed of 125 mph.

I. Bias Type (Rib Design)

<u>S1:50</u>	Brand Name	Construction	Certified Speed Rating
G78-15	Police Special Nylen	4 plies nylon body	125 mph
H78-15	н		Ħ
J78-15	*		

II. Bias Belted Type (Rib Design)

G78-15	Police Special Polyglas	4 plies polyester body + 2 fiberglass belts	125 mph
H78-15		×	
L78-15			W

III. Radial Tires (Rib Design)

<u>S1 ze</u>	Brand Name	Contruction	Speed Rating
DR70-1 4	Police Special Radial	2 plies polyester body + 4 rayon belts	125 mph
GR70-15	11	9	
HR70-15	11	Ħ	
IR7 8-15		10	н
JR78-15	10	н	н
LR78-15	0	н	

In addition to the above rib design tires, a line of winter tread tires is also available, which have been tested and certified up to a minimum speed of 115 mph which is the standard test for Goodyear.

Note: All of the above listed rib and winter tires are supplied in load range B (4 ply rating) construction.

Enclosed is a brochure covering our police special line of tires which provides engineering data for each size.

Very truly yours,

CTWig

Manager Government Sales Department

C T Wig ovk

ATTACHMENT E-6



mailing address: P.O. Box 3467, New Hyde Park P.O., New York 11040

MICHELIN TIRE CORPORATION Technical Group 2500 Marcus Avenue Lake Success, New York tel: (516) 488-3500 (212) 895-0900 cable: Pneumiclin Lake Success

31 March 1975

This is to certify that the following Michelin radial steel-belted tires are designed for maximum speeds up to 130 mph and for handling performance as required in applications such as police pursuit cars.

Tire Size		Revs Overall Overall Loaded Per Max. Tub	e
Designation	Rims	Width Diameter Radius Mile Load PSI Cod	<u>es</u>
205HR14XVS	5, $5\frac{1}{2}$, $6\frac{1}{2}$, $6\frac{1}{2}$, 7, $7\frac{1}{2}$	8.2 27.0 12.2 773 1730 36 14H	913
215HR15XVS	5, $5\frac{1}{2}$, 6, $6\frac{1}{2}$, 7, $7\frac{1}{2}$	8.6 28.5 13.1 726 1860 36 15H	913

JBW:abb

ATTACHMENT E-7

PIRELLI TIRE CORPORATION 600 THIRD AVENUE, NEW YORK, N.Y. 10016 212/490-1300



April 2, 1975

PIRELLI TIRES CERTIFIED FOR POLICE USE

Pirelli makes available tires certified for Police use in sizes 215-15 (replaces HR78-15) and 235-15 (replaces LR78-15). The tires are suitable for applications requiring high speed capabilities, such as Police Pursuit cars, and have:

- black sidewall
- load range B
- max. air pressure 32 P.S.I.
- max. speed rating 130 M.P.H.

ANNOUNCEMENT OF NEW PUBLICATIONS ON NATIONAL CRIME AND RELATED SUBJECTS

Superintendent of Documents, Government Printing Office, Washington, D.C. 20402

Dear Sir:

Please add my name to the announcement list of new publications to be issued on the above subjects (including this NBS series):

Name		
Company		
Address		······································
City	State	Zip Code

(Notification key N-351)

U.S. DEPARTMENT OF COMMERCE National Bureau of Standards Weshington, D.C. 20234

OFFICIAL BUSINESS

Penalty for Private Use, \$300

POSTAGE AND FEES RAID U.S. DEPARTMENT OF COMMERCE COMMERCE



SPECIAL FOURTH-CLASS RATE BOOK